



City of Pembroke Pines Fire Rescue

Fire Prevention Bureau

601 City Center Way 3rd FL
Pembroke Pines, FL 33025
PH (954) 499-9560



FIRE SAFETY INSPECTION REPORT

Occupant Name:	Heron Pond Clubhouse	Inspection Date:	1/19/2023
Address:	8400 Southwest 1 Street	Inspected By:	Victor Santos
Suite:		Property Use Type:	Business office
Occupant Number:	10000222	InspectionType:	Annual Fire Alarm (FAS), Annual Fire and Life Safety Inspection, Annual Gate Inspection
Occ. Sq. Ft.:	4000	Number of AEDs:	0

Insp. Result	Location	Code Set	Code
--------------	----------	----------	------

Deficiency	FL NFPA 101 2018 FIRE ALARM SYSTEM	4.6.12.1 - Annual Insp./Devices not maintained/Trouble
-------------------	---------------------------------------	--

Inspector Comments: ACTION REQUIRED: Fire Alarm System found in trouble / ground fault. Must have a licensed qualified contractor service, repair or replace smoke detector(s).

ACTION REQUIRED: Fire Alarm system annual service needed. Must have a licensed qualified contractor conduct annual service and provide a deficient-free maintenance, inspection and testing report.

Whenever or wherever any device, equipment, system, condition, arrangement, level of protection, fire-resistive construction, or any other feature is required for compliance with the provisions of this Code, such device, equipment, system, condition, arrangement, level of protection, fire-resistive construction, or other feature shall thereafter be continuously maintained. Maintenance shall be provided in accordance with applicable NFPA requirements or requirements developed as part of a performance-based design, or as directed by the authority having jurisdiction.

Deficiency	Pembroke Codes Pembroke Pines Code of Ordinances	COPP CO 93.11 (A) and 155.079 - City Gate Requirements
-------------------	---	--

Inspector Comments: Action Required: Commercial and Residential Entry and Interior Gates. All gates requiring Fire Department Access serving access to any residential or commercial building shall be electrical gates and shall be operated by an Electrical Key operated Knox Box with Fire Department decal with dust cover AND a RADIO FREQUENCY SERVED BY REMOTE CONTROL. The Radio Frequency product shall be compatible to Access Pro Controller, Model AKR-1 and can be obtained through EDL/Gate Master's Service Department @ 954-525-0386. Programming of the Radio Frequency product must be performed by Gate Masters.NFPA 1-18.2.2.1; COPP CO 93.11 (A) and 155.079.

City Motorized Gate Systems

Deficiency	FL NFPA 01 2018 Chapter 10 General Safety Requirements	10.1.4.1 - Excerpt: Where structural elements have visible damage, the AHJ shall... (see photo 1.1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 1.10, 1.11, 1.12, 1.13, 1.14, 1.15, 1.16, 1.17)
-------------------	---	---

Inspector Comments: ***The noted structural damages have been referred to the City's Building Official and Structural Chief for evaluation of possible unsafe conditions. A site visit with structural inspectors and the Building Official to demonstrate areas of concern was conducted. Following the site visit, an structural engineer was consulted and in conjunction with the Building Official, deemed each patio/balcony area unsafe. The Building Official instructed Xochitl Alvarez, the property manager, to produce an analysis and proposal completed by a structural engineer for conditions and repairs within 48 hours. Each building and unit had an "Unsafe Building" notice posted on the front door as well as verbally communicated with residents who were home at the time. Residents were instructed that due to the unsafe conditions, they are to remain clear of the patio/balcony area until further notice is given.***

Where structural elements have visible damage, the AHJ shall be permitted to require a technical analysis prepared in accordance with Section 1.15 to determine if repairs are necessary to restore structural integrity.

Deficiency	FL NFPA 01 2018 OWNER RESPONSIBILITY	10.2.1 - Owner Responsibility
-------------------	---	-------------------------------

Inspector Comments: ****The owner, operator, or occupant shall be responsible for compliance with Florida Life Safety Code.****

Deficiency	Pembroke Codes Pembroke Pines	PPFD 101 - Fire Inspection
-------------------	----------------------------------	----------------------------

ALL VIOLATIONS MUST BE ABATED IMMEDIATELY

Any and all violations must be corrected prior to the noted re-inspection date. Failure to remedy said deficiencies on or before the re-inspection date will result in a re-inspection fee and may also subject you to further action by the Fire Marshal's office.

The Inspector will return on or after **2/20/2023**.

MISSION STATEMENT

"The Pembroke Pines Fire Department is dedicated to the preservation of life, property and the environment. Our goal is to provide quality, cost effective professional services predicated upon the knowledge, skills, and abilities of our members."

Company Representative:


Xochitl Alvarez
1/19/2023

Inspector:


Victor Santos
1/19/2023 4:02:23 PM
Signature valid only in mobile-eye documents
Victor Santos
1/19/2023

1.1 -
10.1.4.1.



1.2 -
10.1.4.1.



1.3 -
10.1.4.1.



1.4 -
10.1.4.1.



1.5 -
10.1.4.1.



1.6 -
10.1.4.1.



1.7 -
10.1.4.1.

1.8 -
10.1.4.1.



1.9 -
10.1.4.1.



1.11 -
10.1.4.1.



1.13 -
10.1.4.1.




1.10 -
10.1.4.1.



1.12 -
10.1.4.1.



1.14 -
10.1.4.1.

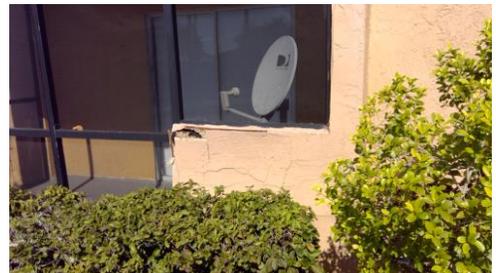




1.15 -
10.1.4.1.



1.17 -
10.1.4.1.

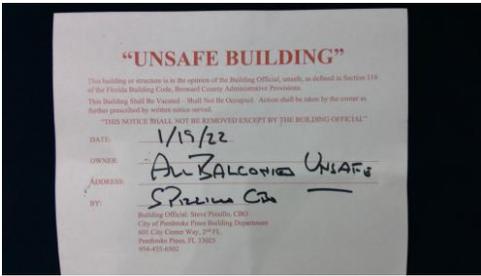

Ref: 67793

1.16 -
10.1.4.1.

